

COZY CABS

MOUNTING INSTRUCTIONS

With Replacement Parts List

for

TORO REELMASTER

450D-4500D

4-Post ROPS A-10969



OPTIONS

A-10968

Canopy Kit



Manufactured by:

CUSTOM PRODUCTS
OF LITCHFIELD, INC.

BOX 718 • LITCHFIELD, MINNESOTA 55355
(320) 693-3221 Fax: (320) 693-7252
1-800-222-5463

MOUNTING INSTRUCTIONS

TORO REELMASTER 450D-4500D

4-POST ROPS

PLEASE COMPLETELY REVIEW INSTRUCTIONS BEFORE INSTALLING ROPS.
If you have any questions or comments please call 1-800-222-5438 and ask for technical assistance with Toro 450D-4500D Series.

PREPARATION OF MACHINE

1. Lower all cutting decks.

INSTALLATION OF ROPS

1. Hoist bar and remove from shipping stand.
2. Lower bar onto machine and position as shown in Figure 1.
3. Position one of the front mounts over the platform aligning it with the holes provided (Figure No. 2). Force the legs of the bar apart to move the other front mount into position.
4. Secure the front mounts to the platform using the four 1/2"-13NC x 5" 82 Deg. socket head mounting bolts, flatwashers, lockwashers and nuts.
5. Use the remaining six 1/2"-13NC x 3 hex head bolts, flatwashers, lockwashers and nuts to secure the rear mounts to the holes provided in the frame. (Figure No. 3).

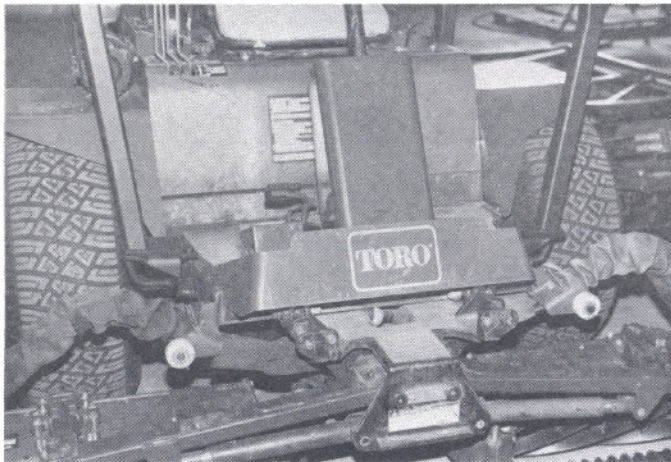


Figure 1



Figure 2

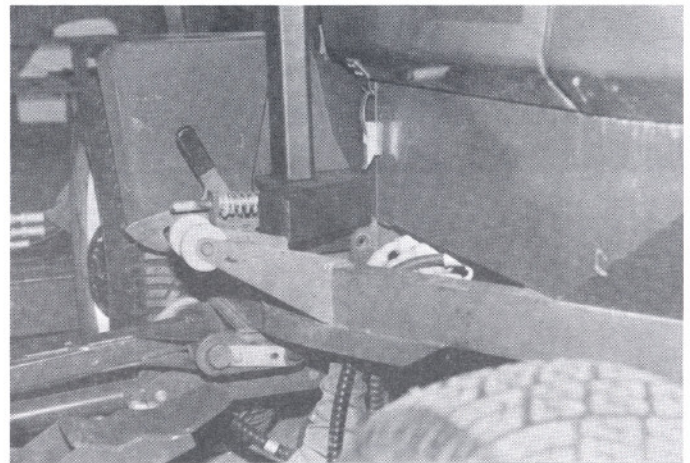


Figure 3

REPLACEMENT PARTS
TORO REELMASTER 450D-4500D MOUNTING KIT

ITEM	QTY	PART NO.	DESCRIPTION
1	6	3-10131	1/2"-13NC x 3" Hex Head Bolt
2	4	3-15951	1/2"-13NC x 5" 82 Deg FHSOC
3	10	3-10079	1/2" Lock Washer
4	16	3-10087	1/2" Flat Washer
5	10	3-10067	1/2"-13NC Hex Nut